


BEKO FLAVEL	SERVICE BULLETIN		Bulletin no	2007-06	Date	09.03.2007
	Prepared by	Yaşar CEYLAN	Signature			
	Approved by	Ibrahim YILDIRIM				
TECHNICAL EXPLANATION OF THE CHANGE						

DOOR HOOD RUBBER (WMA510/520)

Door hood rubbing against steel drum at various spin speeds causing a burning rubber smell or slight smoking.

First check whether the stainless steel drum is coming in touch with the door hood rubber at any point of the circumference

During examination of the door hood rubber if there is sign of rubbing through 180° or 360°, the Door Hood Rubber should be replaced with the replacement part, Part Number 2812380100. If the new Door hood rubber is in contact with the steel drum this will not be a problem.

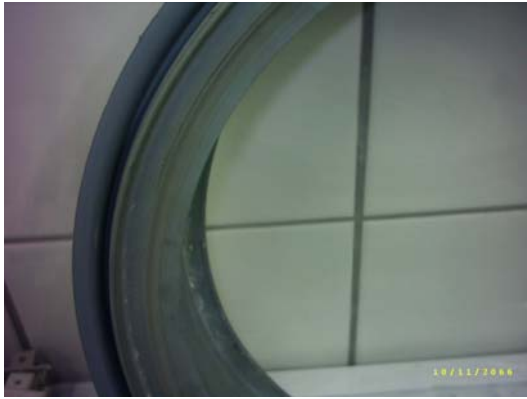

After fitting the new part, load the machine with laundry and softener then run the rinse and spin programme.

During the test run check the washing machine for a rubbing noise or burning rubber smell.

When servicing the Washing Machines for other reasons -

If it has been in the field less than 3 months.

Please check the Door hood rubber for signs of rubbing or any rubber partials, if there is or the customer complains of a burning smell at times, then change the Door hood rubber

