SONY

Technical Bulletin

Date	Ref. No.	Revision	Туре	IRIS	Level	Source		
13.03.12	12PV021	0	REACTIVE		2	TD		
Models								
NEX-3, 5								
Subject: Part number for "LCD Adhesive Sheet" and "LCD901"								


SYMPTOM

The "LCD Adhesive Sheet" and "LCD901" have been introduced for service.

SOLUTION

The new parts can be ordered with the part number info below.


Description	Part number		
LCD Adhesive Sheet	4-186-508-01		
LCD901	8-753-335-38		

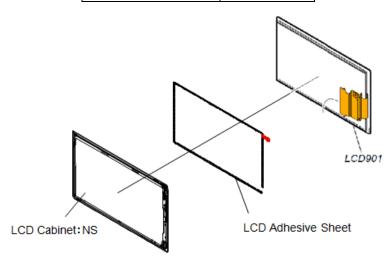

Follow the guidelines below for proper removal / reattachment of "LCD901".

• 1. How to remove LCD901?

1-1. Let alcohol infiltrate along the edges of the panel assembly (red line in picture below).

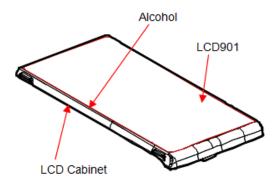

1-2. Remove LCD901 carefully so as not to damage the LCD Cabinet.


2 / 2 12PV021


NOTE: An illustrated procedure on how to remove the LCD901 can be found on the next page.







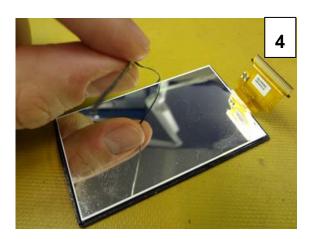

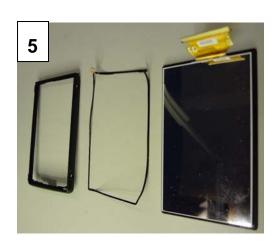

2. How to reattach LCD901?

2-1. Attach the LCD Adhesive Sheet to LCD901 as shown to the right.

NOTE: Make sure the edge of the sheet does not protrude from the LCD901.

2-2. Attach LCD901 to the LCD Cabinet.

